

**Montana US Highway 93 South Wildlife Crossings Research  
MDT # HWY – 308445-RP**

**2012 Second Quarter Progress Report**

Prepared by  
Patricia Cramer, Principal Investigator,  
Consultant, and Research Assistant Professor, Utah State University  
[patricia.cramer@usu.edu](mailto:patricia.cramer@usu.edu)

With assistance from:  
Robert Hamlin, Research Assistant, [hamlin@hotmail.com](mailto:hamlin@hotmail.com)  
Kari E. Gunson, Research Assistant, [kegunson@eco-kare.com](mailto:kegunson@eco-kare.com)

Prepared for the Montana Department of Transportation  
July 31, 2012



## Table of Contents

1. Study Area and Purpose .....	5
2. White-tailed Deer Use of Wildlife Crossing Structure Sites and Wildlife Crossing Structures .....	8
2.1. Methods .....	8
2.1.1. Pre-construction Monitoring .....	8
2.1.2. Post-construction Monitoring .....	9
2.1.3. Control Cameras .....	9
2.1.4. Work this Quarter .....	10
2.2. Results .....	12
2.2.1. Pre-construction Monitoring .....	12
2.2.2. Post-construction Monitoring .....	15
2.2.3. Control Monitoring .....	15
2.3. Anticipated Work .....	15
3. White-Tailed Deer Usage Rates of Wildlife Crossing Structures by Type and Across Types .....	18
4. Relationships among Wildlife Crossing Structures with Landscape Variables and Crossing Rates .....	18
5. Changes in Animal-Vehicle Collisions Between Pre-construction and Post-construction of Wildlife Crossing Structures .....	19
6. Relationships between Animal-Vehicle Collision Numbers and Wildlife Crossing Structures over Time and Space, Kernel Density Analysis .....	20
Major Task Progress .....	21-23

## List of Tables

Table 1. Wildlife Crossings Structures, US Highway 93 South, Montana. . . . .	6
Table 2. Cameras Currently Installed at Wildlife Crossing Structures on US Highway 93 South, Montana, and at Control Sites. . . . .	10-11
Table 3. Summary of Complete Pre-construction Data Sets. . . . .	13-14
Table 4. White-tailed Deer Use of Wildlife Crossing Structures at Individual Camera Locations. . . . .	16-17

## List of Figures

Figure 1. Map of US Highway 93 South Study Area, Montana. . . . .	7
---	---

## 1. Study Area and Purpose

The Montana Department of Transportation (MDT) installed 19 large wildlife crossing structures along US Highway 93 South between Florence and Hamilton from 2004 to 2012. Details of the 19 wildlife crossing structures are presented in Table 1. A map of the study area is presented in Figure 1.

The purpose of this research is to determine the effectiveness of wildlife crossing structures by investigating:

1. white-tailed deer (*Odocoileus virginianus*) use of wildlife crossing structures and wildlife crossing sites,
2. white-tailed deer usage rates of wildlife crossing structures by type and across types (including height, width, length, and material),
3. relationships between usage rates of wildlife crossing structures and landscape variables,
4. changes in animal-vehicle collisions between pre-construction and post-construction of wildlife crossing structures within a twenty-five mile stretch of US Highway 93 South, mile post (mp) 74 to mp 49, and,
5. relationships between animal-vehicle collisions and wildlife crossing structures over time and space.

This research began in 2008 and will be completed in 2015. This research is approximately 54% complete. This report presents preliminary results which preclude discussion and conclusion sections. The project is on time and on budget for all tasks.

**Table 1. Wildlife Crossings Structures, US Highway 93 South, Montana.**

<b>Structures</b>	<b>Year Completed</b>	<b>Approximate Mile Post</b>	<b>Structure Type</b>
Bass Creek North	2005	71	Bridge
Bass Creek South	2005	70	Bridge
Bass Creek Fishing Access	2005	70	Round Corrugated Steel Culvert
Dawn's Crossing	2005	70	Bridge
Kootenai Creek	2009	66	Bridge
McCalla Creek North	2009	66	Bridge
McCalla Creek South	2010	65	Bridge
Kootenai Springs Ranch	2010	65	Concrete Box Culvert
Indian Prairie Loop	2010	63	Concrete Box Culvert
Big Creek	2011	61	Bridge
Axmen Propane	2010	61	Round Corrugated Steel Culvert
Sweathouse Creek	2011	60	Bridge
Bear Creek North	2012	58	Bridge
Bear Creek South	2012	57	Bridge
Mountain Gallery	2011	56	Concrete Box Culvert
Lupine	2012	56	Concrete Box Culvert
Fun Park	2011	55	Concrete Box Culvert
Mill Creek	2011	55	Bridge
Blodgett Creek	2008	50	Bridge

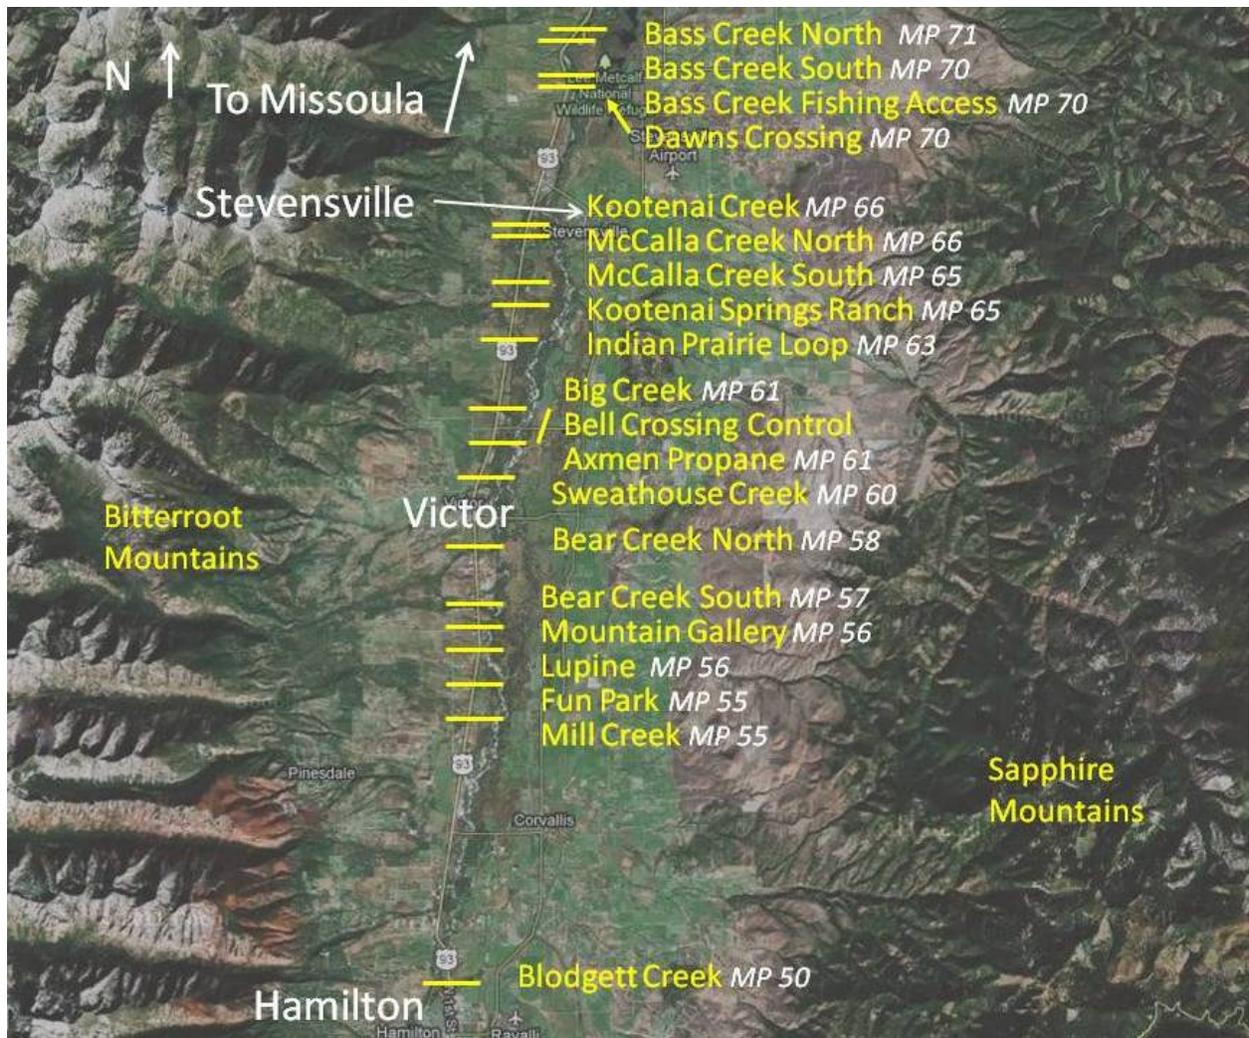


Figure 1. Map of US Highway 93 South Study Area, Montana.

## 2. White-tailed Deer Use of Wildlife Crossing Structure Sites and Wildlife Crossing Structures

### 2.1. Methods

White-tailed deer usage rates were determined by monitoring wildlife crossing structure sites and wildlife crossing structures with Reconyx Professional Cameras, Model PC85 and Model PC800. Cameras were triggered by motion and took pictures of large and small animals, day and night. Cameras were installed inside metal telephone-utility boxes or metal Reconyx Bear Boxes. Each telephone-utility box was secured by a cable locked to the camera on one end and buried in concrete at the other. Reconyx Bear Boxes were mounted on large fence posts or trees and secured with locked cables. All cameras were also secured by electronic code locks.

The following calculations were made for each camera location, where applicable:

- **deer per day** = the total number of deer observed divided by the number of days the camera was in operation
- **success per day** = the total number of deer observed successfully using a wildlife crossing structure divided by the number of days the camera was in operation
- **success rate** = the total number of deer moving through a wildlife crossing structure or onto the road right of way at a wildlife crossing structure site, divided by the total number of deer recorded at the structure or site
- **rate of repellency** = the total number of deer repelled at a wildlife crossing structure or the road right of way at a wildlife crossing structure site divided by the total number of deer recorded at the structure or site
- **parallel rate** = the total number of deer moving parallel to a structure or site right of way divided by the total number of deer recorded at the structure or site.

#### 2.1.1. Pre-construction Monitoring

Two cameras were installed at each of the wildlife crossing structure sites. One camera was placed as near as possible to any original bridge, or the proposed location of the structure. These cameras were designated “structure cameras” if they recorded white-

tailed deer use of the original bridges. A second camera was placed within 50 meters of the first camera at each site. These cameras were designated either “right of way cameras” or “habitat cameras.” Right of way cameras recorded animal movements as they approached or departed the road right of way. Habitat cameras recorded only parallel movements, calculated as deer per day. Pre-construction monitoring was completed in April, 2011.

### **2.1.2. Post-construction Monitoring**

A single camera was installed near one entrance of the following wildlife crossing structures: Bass Creek North (mp 71), Bass Creek South (mp 70), Bass Creek Fishing Access (mp 70), Dawn’s Crossing (mp 70), Kootenai Creek (mp 66), and Blodgett Creek (mp 50). Two cameras were installed, one near each entrance, of the following wildlife crossing structures: McCalla Creek North (mp 66), McCalla Creek South (mp 65), Kootenai Springs Ranch (mp 65), Indian Prairie Loop (mp 63), Axmen Propane (mp 61), Sweathouse Creek (mp 60), Bear Creek North (mp 58), Bear Creek South (mp 57), Mountain Gallery (mp 56), Lupine (mp 56), Fun Park (mp 55), and Mill Creek (mp 55). Three cameras were installed at Big Creek (mp 61). Cameras were placed near the entrances of wildlife crossing structures in order to record the number of white-tailed deer successfully using, moving parallel to, and repelled from the crossing structures. Structures completed prior to this study were monitored with one camera (McCalla Creek North is an exception). Structures completed during this study were monitored with two or more cameras. Pre-construction monitoring data will be compared with post-construction monitoring data, where applicable.

### **2.1.3. Control Cameras**

Two cameras were installed at Bell Crossing (east and west cameras, control) near a bridge over an unnamed spring run on County Road 370, approximately one-quarter mile east of the Bitterroot River. The east camera is a “habitat camera” and the west camera is a road “right of way camera.” This location was selected as a long-term control site to monitor white-tailed deer population and activity in an area where road construction and wildlife crossing structure construction were not scheduled to occur.

One camera was installed at McCalla Creek South (ramp camera, mp 65) to monitor the jump off ramp and to serve as a long-term control site. Big Creek (south camera, control, mp 61) was also selected as a long-term control site.

**2.1.4. Work this Quarter**

During this quarter, over 109,000 images were collected and analyzed. Nine cameras were installed at the following locations: Axmen Propane (west camera, mp 61), Bear Creek North (east and west cameras, mp 58), Bear Creek South (east and west cameras, mp 57), Mountain Gallery (east camera, mp 56), Lupine (east and west cameras, mp 56), and Fun Park (west camera, mp 55) to monitor post-construction activity at these culverts and bridges. One camera was removed (Big Creek, northwest camera, mp 61). Three cameras were repositioned: McCalla Creek South (east and ramp cameras, mp 65) and Kootenai Springs Ranch (east camera, mp 65). Locations, approximate mile posts, and installation dates of cameras currently monitoring post-construction wildlife activity at wildlife crossing structures, and cameras at control sites are presented in Table 2.

**Table 2. Cameras Currently Installed at Wildlife Crossing Structures on US Highway 93 South, Montana, and at Control Sites.**

<b>Camera Location</b>	<b>Approximate Mile Post</b>	<b>Date Installed</b>
Bass Creek North	71	Oct. 10, 2008
Bass Creek South	70	Nov 22, 2008
Bass Creek Fishing Access	70	Nov 22, 2008
Dawn’s Crossing	70	Nov 23, 2008
Kootenai Creek	66	Apr 21, 2009
McCalla Creek North (east camera)	66	Apr 22, 2009
McCalla Creek North (west camera)	66	Apr 22, 2009
McCalla Creek South (east camera)	65	July 30, 2010
McCalla Creek South (west camera)	65	June 16, 2010
McCalla Creek South (ramp camera)	65	June 16, 2010

<b>Camera Location</b>	<b>Approximate Mile Post</b>	<b>Date Installed</b>
Kootenai Springs Ranch (east camera)	65	June 10, 2010
Kootenai Springs Ranch (west camera)	65	July 29, 2010
Indian Prairie Loop (east camera)	63	Oct 25, 2011
Indian Prairie Loop (west camera)	63	Sept 27, 2010
Big Creek (northeast camera)	61	July 28, 2011
Big Creek (southeast camera)	61	July 29, 2011
Big Creek (southwest camera)	61	Aug 12, 2011
Big Creek (south camera, control)	61	Apr 21, 2009
Axmen Propane (east camera)	61	Sept 28, 2010
Axmen Propane (west camera)	61	April 25, 2012
Sweathouse Creek (east camera)	60	Dec 10, 2011
Sweathouse Creek (west camera)	60	Dec 10, 2011
Bear Creek North (east camera)	58	June 25, 2012
Bear Creek North (west camera)	58	June 25, 2012
Bear Creek South (east camera)	57	June 26, 2012
Bear Creek South (west camera)	57	June 26, 2012
Mountain Gallery (east camera)	56	April 25, 2012
Mountain Gallery (west camera)	56	Mar 2, 2012
Lupine (east camera)	56	June 27, 2012
Lupine (west camera)	56	June 26, 2012
Fun Park (east camera)	55	Mar 2, 2012
Fun Park (west camera)	55	April 25, 2012
Mill Creek (east camera)	55	Dec 10, 2011
Mill Creek (west camera)	55	Mar 2, 2012
Blodgett Creek	50	Mar 15, 2010
Bell Crossing (east camera, control)	CR 370	May 29, 2009
Bell Crossing (west camera, control)	CR 370	May 29, 2009

## **2.2. Results**

### **2.2.1. Pre-construction Monitoring**

Pre-construction monitoring was completed in April, 2011. Twenty-six pre-construction data sets are summarized by camera designation in Table 3. The order of camera locations is based on the number of deer per day photographed at each camera site. The pre-construction Bear Creek South bridge was functioning as a successful wildlife crossing structure, even though it was not designed as one (success rate 98%). The success rate for the other five structure cameras monitoring original bridges averaged 11%. For road right of way cameras, the average success rate was 59% and the average rate of repellency was 8% (n=10, excluding Lupine north right of way). The road right of way cameras recorded 1,755 deer successfully crossing US Highway 93 during pre-construction.

**Table 3. Summary of Complete Pre-construction Data Sets.**

<b>Structure Camera Location</b>	<b>Mile Post</b>	<b>Camera Days</b>	<b>Deer Per Day</b>	<b>Successful Crossings</b>	<b>Success Rate (%)</b>	<b>Rate of Repellency (%)</b>	<b>Parallel Rate (%)</b>
Bear Creek South (structure)	57	629	2.6	1662	98	1	1
McCalla Creek South (structure)	65	109	2.3	21	9	7	84
Sweathouse Creek (structure)	60	452	1.1	65	13	1	86
Big Creek (structure)	61	277	0.8	33	14	14	72
Mill Creek (structure)	55	599	0.07	1	3	0	97
Bear Creek North (structure)	58	536	0.03	2	14	14	72
<b>Right of Way Camera Location</b>	<b>Mile Post</b>	<b>Camera Days</b>	<b>Deer Per Day</b>	<b>Successful Crossings</b>	<b>Success Rate (%)</b>	<b>Rate of Repellency (%)</b>	<b>Parallel Rate (%)</b>
Kootenai Springs Ranch (east right of way)	65	107	2.1	78	32	8	60
Fun Park (east right of way)	55	490	1.5	606	79	11	10
Mill Creek (right of way)	55	566	1.2	525	70	15	15
Kootenai Springs Ranch (west right of way)	65	55	0.9	26	54	10	36
Sweathouse Creek (right of way)	60	503	0.8	219	52	4	44
Bear Creek South (right of way)	57	509	0.4	140	68	7	25
Mountain Gallery (north right of way)	56	440	0.3	64	45	4	51
Fun Park (west right of way)	55	556	0.2	57	52	3	45

<b>Right of Way Camera Location</b>	<b>Mile Post</b>	<b>Camera Days</b>	<b>Deer Per Day</b>	<b>Successful Crossings</b>	<b>Success Rate (%)</b>	<b>Rate of Repellency (%)</b>	<b>Parallel Rate (%)</b>
Lupine (south right of way)	56	172	0.1	16	80	15	5
Mountain Gallery (south right of way)	56	587	0.06	24	61	3	36
Lupine (north right of way)	56	204	0.005	0	0	100	0
<b>Habitat Camera Location</b>	<b>Mile Post</b>	<b>Camera Days</b>	<b>Deer Per Day</b>				
McCalla Creek South (habitat)	65	93	5.0				
Indian Prairie Loop (north habitat)	63	78	4.7				
Indian Prairie Loop (south habitat)	63	150	4.5				
Big Creek (habitat)	61	260	2.2				
Axmen Propane (north habitat)	61	212	1.5				
Lupine (west habitat)	56	382	1.3				
Bear Creek North (habitat)	58	454	0.6				
Lupine (east habitat)	56	385	0.6				
Axmen Propane (south habitat)	61	176	0.4				

### **2.2.2. Post-construction Monitoring**

Post-construction monitoring of all 19 wildlife crossing structures is ongoing. White-tailed deer use of wildlife crossing structures at individual camera locations is presented in Table 4. During this study, cameras recorded individual white-tailed deer successfully moving through wildlife crossing structures on 10,184 occasions (this number includes data from Bear Creek South reported in Table 3). The order of camera locations is based on success per day. Camera data reported were analyzed through June 27, 2012.

### **2.2.3. Control Monitoring**

Control camera data were analyzed through March 2, 2012. At Bell Crossing (west camera, control) 2.7 deer per day were recorded. Deer successfully crossed County Road 370 on 1,719 occasions. The success rate was 63%, the rate of repellency was 5%, and the parallel rate was 32%. At Bell Crossing (east camera, control) 2.6 deer per day were recorded. At Big Creek (south camera, control), there were 2.2 deer per day during pre-construction monitoring, 1.3 deer per day during construction, and 1.0 deer per day post-construction. At McCalla Creek South (ramp camera) 5 deer per day were recorded during pre-construction, 0.5 deer per day during construction, and 1.4 deer per day post-construction.

### **2.3. Anticipated Work**

- Ongoing monitoring and data analysis.

**Table 4. White-tailed Deer Use of Wildlife Crossing Structures at Individual Camera Locations.**

<b>Camera Location</b>	<b>Mile Post</b>	<b>Camera Days</b>	<b>Number of Deer</b>	<b>Success Per Day</b>	<b>Successful Crossings</b>	<b>Success Rate (%)</b>	<b>Rate of Repellency (%)</b>	<b>Parallel Rate (%)</b>
Dawn's Crossing	70	1308	2397	1.8	2385	96	2	2
Kootenai Creek	66	1086	1958	1.7	1865	91	4	5
Bass Creek Fishing Access	70	1301	1644	1.2	1622	96	3	1
Blodgett Creek	50	794	615	0.8	600	95	2	3
McCalla Ck North (east cam)	66	1027	899	0.8	809	86	3	11
Big Creek (southwest cam)	61	321	187	0.5	147	76	19	5
Big Creek (northeast cam)	61	288	150	0.5	144	93	4	3
McCalla Ck North (west cam)	66	989	639	0.5	497	77	11	12
Big Creek (northwest cam)	61	272	58	0.2	56	97	0	3
Big Creek (southeast cam)	61	330	83	0.2	64	74	14	12
McCalla Ck South (east cam)	65	682	265	0.2	135	51	7	42
McCalla Creek South (west cam)	65	722	260	0.2	134	51	16	33
Sweathouse Creek (east cam)	60	200	54	0.2	43	77	21	2
Bass Creek North	71	1251	389	0.2	198	50	7	43
Axmen Propane (west cam)	61	64	19	0.1	8	42	37	21
Kootenai Springs Ranch (west cam)	65	621	867	0.06	40	5	11	84
Kootenai Springs Ranch (east cam)	65	684	612	0.06	40	7	7	86

<b>Camera Location</b>	<b>Mile Post</b>	<b>Camera Days</b>	<b>Number of Deer</b>	<b>Success Per Day</b>	<b>Successful Crossings</b>	<b>Success Rate (%)</b>	<b>Rate of Repellency (%)</b>	<b>Parallel Rate (%)</b>
Indian Prairie Loop (west cam)	63	640	739	0.05	26	4	7	89
Axmen Propane (east cam)	61	632	533	0.02	13	3	10	87
Indian Prairie Loop (east cam)	63	247	120	0.04	9	7	13	80
Mill Creek (east cam)	55	200	9	0.04	7	78	22	0
Sweathouse Ck (west cam)	60	187	20	0.09	17	85	10	5
Bass Creek South	71	1243	13	0.004	5	36	14	50
Mill Creek (west cam)	55	117	9	0	0	0	89	11
Fun Park (east cam)	55	118	86	0	0	0	7	92
Fun Park (west cam)	55	51	42	0	0	0	10	90
Mountain Gallery (east cam)	56	64	4	0	0	0	0	100
Mountain Gallery (west cam)	56	89	9	0	0	0	11	89
Bear Ck North (east cam)	58	0	0	0	0	0	0	0
Bear Ck North (west cam)	58	0	0	0	0	0	0	0
Bear Ck South (east cam)	57	0	0	0	0	0	0	0
Bear Ck South (west cam)	57	0	0	0	0	0	0	0
Lupine (east cam)	56	0	0	0	0	0	0	0
Lupine (west cam)	56	0	0	0	0	0	0	0

### **3. White-Tailed Deer Usage Rates of Wildlife Crossing Structures by Type and Across Types**

A detailed statistical analysis of white-tailed deer usage rates of wildlife crossing structures by type and across types will be reported when data are compiled.

Multivariate statistics will be used to analyze how variables such as height, width, length, shape, construction material, and human presence or other disturbances may affect usage rates.

### **4. Relationships among Wildlife Crossing Structures with Landscape Variables and Crossing Rates**

A methodology was developed to quantify landscape variables such as road, traffic, vegetation, topography, and deer fecal pellets at wildlife crossing structures and sites. Data was collected in 2010 at wildlife crossing structures, wildlife crossing structure sites, and control sites, except for the following: Indian Prairie Loop, Big Creek, and Axmen Propane. Construction activities were occurring at these three locations; and landscape variables there were drastically changed by the recent construction activities. Data will be collected at all structures and sites in 2012.

Vegetation data were collected in 25 plots in a 25 meter grid, on each side of the structure or site (50 total plots, each 25 meters apart). Each plot was a circle with a 2 meter radius. Vegetation was categorized as trees, shrubs, or grasses/non-woody and the percentage cover (density) of each category was visually estimated.

Fecal pellets were counted in the 50 plots at each structure or site as described above, and tabulated as number of piles (a pile was more than 10 pellets) and number of scatters (a scatter was less than 10 pellets). Pellet counts will be analyzed to determine

if they can be used as an index or estimate of deer density. Statistical analyses will also explore if pellet data correlate with vegetation and number of deer photographed at the structure or site.

Vegetation characteristics and deer density at each structure and control site may be analyzed in an Akaike Information Criterion (AIC). AIC-based statistics allow multiple statistical models to be built. The AIC software selects the most appropriate model that explains deer presence as related to the different landscape variables. The researchers will conduct a literature search to determine how other studies have used this analysis to predict animal presence. This is but one of several statistical analyses to be used.

## **5. Changes in Animal-Vehicle Collisions between Pre-construction and Post-construction of Wildlife Crossing Structures**

Generalized Linear Models (GLM) will be used to analyze changes in animal-vehicle collisions (AVC) between pre-construction and post-construction of wildlife crossing structures. A direct comparison of pre-construction and post-construction AVC would be incomplete because deer density and traffic volume change over time. GLM developed for this study will determine how deer density and traffic volume influence AVC and may predict future AVC if there were no wildlife crossing structures, based on pre-construction data. The predicted AVC can be compared to actual AVC once wildlife crossing structures and fencing are completed.

Work continued on model building this quarter. In order for the models to best predict what the AVC would be in the future without wildlife crossings, existing data sets on deer carcasses collected from AVC, traffic volume, and deer density need to be as accurate and complete as possible. On June 1, 2012, Kari Gunson and Patricia Cramer participated in a conference call with Mark Greenwood of Montana State University concerning data sets and statistical analyses. The accuracy of the three data sets and

how the data would be read into statistical software programs were discussed. Several future actions were decided upon.

Traffic counter data sets will be analyzed to make predictions on traffic volumes at counter locations during the periods when individual counters were not operating.

When deer carcass (AVC) data collected from 1998 through 2010 were plotted, a noticeable dip in the AVC numbers from 2005 through 2008 became a concern for the team. The hunter harvest data of white-tailed deer in this area for this period did not reflect a similar reduction. A July meeting was set up for Dr. Cramer to meet with MDT maintenance supervisors on this stretch of US 93 to better understand if the carcass collection effort may have changed over those years. That information will be necessary to better build prediction models.

Ms. Gunson will continue to manipulate data into Excel spreadsheets that can allow fine scale (by mile post, by month, by year) and coarse scale (entire study site, by year) analyses of the traffic volume, deer density, and AVC during the pre-construction period.

Dr. Cramer, Ms. Gunson, and Dr. Greenwood have conference calls scheduled in the coming months. This is in preparation for Dr. Greenwood to receive the complete data sets that allow future statistical analyses to predict AVC based on the pre-construction period.

## **6. Relationships between AVC Numbers and Wildlife Crossing Structures over Time and Space, Kernel Density Analysis**

Additional kernel density analysis will continue as new wildlife crossing structures are completed and AVC data are collected.

## Major Task Progress

Task	Description	Estimated Span of calendar years Estimated after kickoff	Cost	Total billed to date	Percentage complete: based on percentage complete & billed this report as a % of original budget
1	Task 1 Purchase equipment	Oct 1, 08 - Aug 31, 09	\$49,650	44,151	89%
2	Task 2 Install equipment...	Oct 9, 08 – Aug 31, 09	6,300	6,300	100%
3	Task 3 Monitor wildlife movement	Nov 1 08 – May 1, 09, 6 months	18,105	18,105	100%
4	Task 4 Obtain & analyze current a-v-c	Fall, 08 - Aug 31, 09	8,520	8,520	100 %
5	Task 5 Hold public meeting	Summer 09	Not applicable	Not applicable	Not applicable
6	Task 6 Create a-v-c prediction models	Spring/ Summer/ Fall 09	9,880	1,298	13%
7	Task 7 Monitor wildlife movement	May 1, 09- April 30 '10 = 12 months	41,810	41,810	100%
8	Task 8 Create Interim Report	Aug 09	3,720	3,720	100%
9	Task 9 Hold public meeting	Summer '10	2,760	2,760	100%
10	Task 10 Monitor wildlife movement	May 1 10 – April 30 '11 = 12 months	40,560	40,560	100%
11	Task 11 Create Interim Report	Jan 1 '10- Dec 31 '10	3,720	3,720	100%

<b>Task</b>	<b>Description</b>	<b>Estimated Span of calendar years Estimated after kickoff</b>	<b>Cost</b>	<b>Total billed to date</b>	<b>Percentage complete: based on percentage complete &amp; billed this report as a % of original budget</b>
12	Task 12 Analyze pre-construction data	July '09 – June '10	13,360	5,754	43%
13	Task 13 Reinstall Equipment	June '10 – July '11	2,760	2,760	100%
14	Task 14 Monitor Wildlife Movement	May '11 – April '30 12	40,560	40,560	100%
15	Task 15 Create Interim Report	Jan 1 '11 – Dec 31 '11	3,720	3,720	100%
16	Task 16 Analyze pre-construction data & compare to predicted	June 1 '12 – Dec 31 '13	14,800	0	0
17	Task 17 Hold public meeting- Changed to re-install cameras	2012	3,690	3,690	100%
18	Task 18 Monitor wildlife movement	May 1, 2012- April 30, 2013	40,560	6,760	17%
19	Task 19 Create Interim Report	Jan 1 2012 – Dec 31 2012	3,720	0	0
20	Task 20 Hold public meeting	2013	2,760	na	na
21	Task 21 Monitor wildlife movement	May 1, 2013- April 30, 2014	40,560	0	0
22	Task 22 Create Interim Report	Jan 1 2013 – Dec 31	2,080	0	0

<b>Task</b>	<b>Description</b>	<b>Estimated Span of calendar years Estimated after kickoff</b>	<b>Cost</b>	<b>Total billed to date</b>	<b>Percentage complete: based on percentage complete &amp; billed this report as a % of original budget</b>
		<b>2013</b>			
<b>23</b>	<b>Task 23 Hold public meeting</b>	<b>2014</b>	<b>2,760</b>	<b>na</b>	<b>na</b>
<b>24</b>	<b>Task 24 Monitor wildlife movement</b>	<b>May 1, 2014- April 30, 2015</b>	<b>40,560</b>	<b>0</b>	<b>0</b>
<b>25</b>	<b>Task 25 Create Interim Report</b>	<b>Jan 1 2014 – Dec 31 2014</b>	<b>2,080</b>	<b>0</b>	<b>0</b>
<b>26</b>	<b>Task 26 Analyze avc data and compare results with expected</b>	<b>2014 - June 30, 2015</b>	<b>18,800</b>	<b>0</b>	<b>0</b>
<b>27</b>	<b>Task 27 Hold public meeting</b>	<b>2015</b>	<b>2,760</b>	<b>na</b>	<b>na</b>
<b>28</b>	<b>Task 28 Submit draft final report</b>	<b>June 30 2015</b>	<b>16,520</b>	<b>0</b>	<b>0</b>
<b>29</b>	<b>Task 29 Meet with MDT officials</b>	<b>Summer 2015</b>	<b>3,680</b>	<b>0</b>	<b>0</b>
<b>30</b>	<b>Task 30 Submit final report</b>	<b>Sept 30 2015</b>	<b>27,040</b>	<b>0</b>	<b>0</b>
	<b>Total</b>		<b>467,795</b>	<b>234,188</b>	<b>50%</b>

\* na = not applicable